

# Work Order ID 89418

\*89418\*

Page 1

August-22-12 7:14:08 AM

Item ID: D412-664-203

Accept

\*N900040100\*

Setup Start

\*NS1\*

Revision ID:

Stop

\*NS2\*

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Run Start

\*NR1\*

Approvals: Process Plan: *MLJ*

Date: *12/08/22* Tooling:

Date:

QC:

Date: SPC (Y/N):

Date:

Stop

\*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr.

Revision Nbr

D412-664-243

E/DEO

100

0.00

\*100\*

DOCUMENT CONTROL

DC

Memo

0.00

Document Control

Photocopy bluefile and create labels as per PPP D412-664-203 CHG

110

0.00

\*110\*

Packaging

P

Memo

0.00

MACHINE - CROSSTUBES

0.00

0.00

Dwg D412-664-243 using CNC bender program 412-aft and

*D412-664-243*  
*16*  
*17/08/22*

*per ECN 12-643*

*MO 12/8/22*

*MO/RM 12-8-22*

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input checked="" type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/> Equip/Tooling <input type="checkbox"/> Operator <input type="checkbox"/> Material <input type="checkbox"/> Setup <input type="checkbox"/> Other <input type="checkbox"/> Process <input type="checkbox"/> Supplier <input type="checkbox"/> Training <input type="checkbox"/> Unapproved <input type="checkbox"/>	12/8/23	120	1	CRUSHING AFTER BENDING IS <del>9/12</del> OVER TOLERANCE.	DAS 12/8/23	ACCEPTABLE PER ATTACHED S.R.	12/8/23				

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

# Work Order ID 89418

August-22-12 7:14:08 AM

**\*89418\***

Page 2

Item ID: D412-664-203

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 <b>*130*</b> QC Quality Control	QC15- Crosstube Dimensional Check  Memo	0.00  0.00							
140 <b>*140*</b> Crosstubes Crosstubes	Crosstubes  Memo 1-Drill pilot holes in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551 and drill table DT8577 using #9 holes as per QSI 10 to install towers. 2-Ream hole to finish size in tube as per Dwg D412-664-243 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-SCRIBE PART # & BATCH # 4- *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D412-664-243	0.00  0.00							

DAS  
16  
2-83

Dec/23

JW

12-8-23

JW

12-8-30

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

Landing Gear	General	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized
		<input type="checkbox"/> Over/Under tolerance
		<input type="checkbox"/> Part Incorrect
		<input type="checkbox"/> Part Lost/Missing
		<input type="checkbox"/> Part Moved
		<input type="checkbox"/> Positioned Wrong
		<input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced
		<input type="checkbox"/> Temperature/Cure
		<input type="checkbox"/> Weld
		<input type="checkbox"/> Wrong Stock Pulled
		<input type="checkbox"/> Other

**Work Order ID 89418**

August-22-12 7:14:08 AM

**\*89418\***

Page 3

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	QC5- Inspect part completeness to step on W/O	0.00							
<b>*160*</b>									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
170		0.00							
<b>*170*</b>									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- CLEAN CROSSTUBE WITH WASH'N WIPE								
180	Outsource process - NDT per QSI038 4.1	0.00							
<b>*180*</b>									
Outsource2	Memo	0.00							
Outsource process - NDT	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Liquid Penetrant Inspection as per QSI 038Or Issue P/O: 17805 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								

DAS  
16  
9-89 12/08/30

AL 12-8-30

CL 12/08/30 (1)

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											
<b>FAULT CATEGORY</b>											
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other		

**Work Order ID 89418**

August-22-12 7:14:08 AM

**\*89418\***

Page 4

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	Packaging	0.00							
<b>*190*</b>									
Packaging	Memo	0.00							
Packaging	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Inspect for transit damage								
	Ensure copy of NDT results attached to work order.								
200	QC5- Inspect part completeness to step on W/O	0.00							
<b>*200*</b>									
QC	Memo	0.00							
Quality Control	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	Inspect for damage & ensure results are as per Dwg D412-664-203								
203		0.00							
<b>*203*</b>									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***								
	1- PRESSURE WASH AND THEN USE WASH'N WIPE TO CLEAN CROSSTUBE BEFORE CHEMICAL CONVERSION								

*11/28/30**12-09-06**12-8-30*

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other



**Work Order ID 89418**

August-22-12 7:14:08 AM

**\*89418\***

Page 5

Item ID: D412-664-203

Accept

**\*N900040100\***Setup Start **\*NS1\***

Revision ID:

Item Name: Crosstube Aft

Stop **\*NS2\***

Start Date: 22/08/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start **\*NR1\***

QC:

Date:

SPC (Y/N):

Date:

Stop **\*NR2\***Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run Hours

Tool ID Tool #

Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

205

QC7-Inspect Chemical Conversion Coat

0.00

**\*205\***

QC

Memo

0.00

Quality Control

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

12.09.06

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
<b>Landing Gear</b>			<b>General</b>						
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized	<input type="checkbox"/> Pressure/Forced					
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance	<input type="checkbox"/> Temperature/Cure					
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect	<input type="checkbox"/> Weld					
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing	<input type="checkbox"/> Wrong Stock Pulled					
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved						
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong						
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Other					
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset							
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration							
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence							
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions							

# Work Order ID 89418

\*89418\*

Page 6

August-22-12 7:14:08 AM

Item ID: D412-664-203

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Run Start \*NR1\*

Approvals: Process Plan: Date:

Tooling: Date:

Stop \*NR2\*

QC: Date:

SPC (Y/N): Date:

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

0.00

\*210\*

SprayPaint

0.00

SprayPaint

Memo

Spray Painting

\*\*\* WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE\*\*\*

\*\*\*Mask underside of crosstube as shown\*\*\*

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per DEO D412-664-243 and QSI 005 4.2

PRIME:

Start Time: 8:00 > W 12.09.06

Finish Time: 9:00

PAINT:

Start Time: 8:30 > W 12.09.07

Finish Time: 9:30

3- Apply clear coat after paint as per DEO

12/09/07

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge    		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Work Order ID 89418

\*89418\*

Page 7

August-22-12 7:14:08 AM

Item ID: D412-664-203

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

\*1\*

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

\*1\*

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start \*NR1\*

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220 QC14- Inspect Spray Paint

0.00

\*220\*

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

① B 120907

230

0.00

\*230\*

Crosstubes

Crosstubes

Memo

0.00

Crosstubes

Assemble as per Dwg D412-664-203

1- Install chafing shield as per DEO D412-664-243. Top holes should be facing up.

A/R Proseal 890 Batch: 122782  
EXP: 11/12/13

2- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

3- Install support with Scotch-Weld DP460 and install clamps as per DEO Dwg D12-664-243 using installation jig DT9024. Torque clamps as per dwg

A/R Scotch-Weld DP460 Batch: 121368  
EXP: 13-4-13

chafing shield  
Rev. C  
per EN12643

AB 12-9-14  
see DEO attached for placement

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabelled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Work Order ID 89418

\*89418\*

Page 8

August-22-12 7:14:08 AM

Item ID: D412-664-203

Accept

\*N900040100\*

Setup Start \*NS1\*

Revision ID:

Stop \*NS2\*

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00 \*1\*

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00 \*1\*

Customer:

Reference:

Approvals: Process Plan: Date: Tooling: Date:

Run Start \*NR1\*

QC: Date: SPC (Y/N): Date:

Stop \*NR2\*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	QC5- Inspect part completeness to step on W/O	0.00							
*240*									
QC	Memo	0.00							
Quality Control									
250	Pick Kit	0.00							
*250*									
Packaging	Memo	0.00							
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00							
*260*									
QC	Memo	0.00							
Quality Control									

W121203

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>		Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector	
Doc/Data	<input type="checkbox"/>										
Equip/Tooling	<input type="checkbox"/>										
Operator	<input type="checkbox"/>										
Material	<input type="checkbox"/>										
Setup	<input type="checkbox"/>										
Other	<input type="checkbox"/>										
Process	<input type="checkbox"/>										
Supplier	<input type="checkbox"/>										
Training	<input type="checkbox"/>										
Unapproved	<input type="checkbox"/>										

FAULT CATEGORY												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	



# Work Order ID 89418

August-22-12 7:14:08 AM

**\*89418\***

Page 9

Item ID: D412-664-203

Accept

**\*N900040100\***

Setup Start **\*NS1\***

Revision ID:

Stop **\*NS2\***

Item Name: Crosstube Aft

Start Date: 22/08/2012 Start Qty: 1.00

**\*1\***

Cust Item ID:

Required Date: 05/09/2012 Req'd Qty: 1.00

**\*1\***

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start **\*NR1\***

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop **\*NR2\***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
270		0.00							
<b>*270*</b>	Packaging								
Packaging	<b>Memo</b>	0.00							
Packaging	Identify and pack for shipping as per PPP D412-664-203 *****Ensure tube is not packaged if curing time is less than 12 hrs, see step 27 for application time & date ***** Time & date of packaging: _____ Location: _____								
280	QC21- Final Inspection - Work Order Release	0.00							
<b>*280*</b>									
QC	<b>Memo</b>	0.00							
Quality Control									

remove paint  
and chafing shields  
require for testing - Excor  
per Mike L see attached Email

RD 3380

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Picklist Print

August-22-12 7:14:13 AM

Page 1

Work Order ID: 89418

**\*89418\***

Parent Item: D412-664-203

**\*D412-664-203\***

Parent Item Name: Crosstube Aft

Start Date: 22/08/2012

Required Date: 05/09/2012

Start Qty: 1.00

Required Qty: 1.00

**Comments:**  
 IPP Rev:E04.02.16Reformat; Added D3189-IK/DS  
 IPP Rev:F 06-03-29 Remove Coments on Pick List JLM  
 IPP Rev:G 06.12.08 per ECN 886 EC  
 IPP Rev:H 07-04-30 As per Rev D JLM  
 IPP Rev:I 08-06-12 add comment in seq. 21 DD verified by:EC IPP rev J  
 11.04.21 DEO D412-664-243-E-1 EC verified DD IPP REV:K  
 11.10.03 DEO D412-664-243-E-2 DD verf:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D412-664-203TRN		Manufactured	No			110	Each	10.0000	1	1			

**\*D412-664-203TRN\***

Crosstube Turning Detail

**\*\***

Location	Loc Qty	Loc Code
LG	10	
83835	1	
87157	1	
87158	1	
87160	1	
88779	1	
88785	1	
88786	1	
88787	1	
88788	1	
88789	1	

D2896-1

Manufactured No

230

Each

14.0000

1

1

**\*D2896-1\***

Support

**\*\***

Location	Loc Qty	Loc Code
LG052	6	
80586	6	
LG053	8	
74465	8	

MO 12/8/22

AB 12-9-13

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY				
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other	

# Picklist Print

August-22-12 7:14:13 AM

Page 2

Work Order ID: 89418

Parent Item: D412-664-203

Parent Item Name: Crosstube Aft

\*89418\*

\*D412-664-203\*

Start Date: 22/08/2012

Required Date: 05/09/2012

Start Qty: 1.00

Required Qty: 1.00

D3189-1

Manufactured No

230

Each

41.0000

2

2

\*D3189-1\*

Chafing Shield

\*\*

AS 12-9-14

89804

(2)

Location

Loc Qty

Loc Code

FG

4

36065

4

LG052

26

86652

26

LG053

11

85515

11

D3595-063-570

Manufactured No

230

Each

131.0000

2

2

\*D3595-063-570\*

RUBBER CUSHION

\*\*

AS 12-9-14

Location

Loc Qty

Loc Code

FG

8

37971

1

42243

7

LG

78

83294

78

MAT052

45

71534

1

76546

44

(2)

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	

# Picklist Print

August-22-12 7:14:13 AM

Page 3

Work Order ID: 89418

Parent Item: D412-664-203

Parent Item Name: Crosstube Aft

\*89418\*

\*D412-664-203\*

Start Date: 22/08/2012

Required Date: 05/09/2012

Start Qty: 1.00

Required Qty: 1.00

MS21920-28

Purchased

No

230

Each

82.0000

4

4

\*MS21920-28\*

Clamp(per MIL-DTL-8783C)

\*\*

AP 12-9-14

Location

Loc Qty

Loc Code

FG

5

105884

5

LG050

55

118713

3

120054

2

122518

50

LG051

22

121440

8

122204

14

MS21920-30

Purchased

No

230

Each

79.0000

2

2

\*MS21920-30\*

clamp(per MIL-DTL-8783C)

\*\*

AP 12-9-14

Location

Loc Qty

Loc Code

LG

16

119529

16

LG051

63

111258

14

121583

49

Purchased

No

250

Each

126.0000

4

4

AN6-40A

\*AN6-40A\*

Bolt

\*\*

AP 12/9/18

Location

Loc Qty

Loc Code

ST340

50

122416

50

ST342

76

120187

66

120833

4

121827

6

return to stock

August-22-12 7:14:13 AM

Shop Packet Print

Page 3

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY			
<b>Landing Gear</b>  <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b>  <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other



# Picklist Print

August-22-12 7:14:13 AM

Page 4

Work Order ID: 89418

\*89418\*

Parent Item: D412-664-203

\*D412-664-203\*

Parent Item Name: Crosstube Aft

Start Date: 22/08/2012

Required Date: 05/09/2012

Start Qty: 1.00

Required Qty: 1.00

AN6-41A

Purchased

No

250

Each

91.0000

2

2

\*AN6-41A\*

Bolt

\*\*

Location

Loc Qty

Loc Code

ST340

50

122407

50

ST342

41

120423

11

121825

30

AN960JD616

NAS1149D0663J

Purchased

No

250

Each

0.0000

18

18

\*AN960JD616\*

Washer

\*\*

MS21042L6

Purchased

No

250

Each

875.0000

6

6

\*MS21042L6\*

Nut

\*\*

Location

Loc Qty

Loc Code

314

584

122441

584

ST300

291

117677

25

118384

3

118927

48

119075

15

120308

200

Return to  
M/2302/18  
12/1/18

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_


QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
<input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
<input type="checkbox"/>											
Operator <input type="checkbox"/>											
<input type="checkbox"/>											
Material <input type="checkbox"/>											
<input type="checkbox"/>											
Setup <input type="checkbox"/>											
<input type="checkbox"/>											
Other <input type="checkbox"/>											
<input type="checkbox"/>											
Process <input type="checkbox"/>											
<input type="checkbox"/>											
Supplier <input type="checkbox"/>											
<input type="checkbox"/>											
Training <input type="checkbox"/>											
<input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
<b>Landing Gear</b>			<b>General</b>						
<input type="checkbox"/>	Bending	<input type="checkbox"/>	Bend	<input type="checkbox"/>	Grain	<input type="checkbox"/>	Ovalized	<input type="checkbox"/>	Pressure/Forced
<input type="checkbox"/>	Centre Not Concentric to O/S	<input type="checkbox"/>	BOM/Route	<input type="checkbox"/>	Hardware	<input type="checkbox"/>	Over/Under tolerance	<input type="checkbox"/>	Temperature/Cure
<input type="checkbox"/>	Cracks	<input type="checkbox"/>	Broken/Damaged	<input type="checkbox"/>	Inspection Incomplete	<input type="checkbox"/>	Part Incorrect	<input type="checkbox"/>	Weld
<input type="checkbox"/>	Crushed/Crimped	<input type="checkbox"/>	Burrs	<input type="checkbox"/>	Instructions Incomplete/Unclear	<input type="checkbox"/>	Part Lost/Missing	<input type="checkbox"/>	Wrong Stock Pulled
<input type="checkbox"/>	Cuffs	<input type="checkbox"/>	Contamination	<input type="checkbox"/>	Maintenance	<input type="checkbox"/>	Part Moved	<input type="checkbox"/>	Other
<input type="checkbox"/>	Heat Treat	<input type="checkbox"/>	Countersink	<input type="checkbox"/>	Mislabeled	<input type="checkbox"/>	Positioned Wrong		
<input type="checkbox"/>	Inspection Strip in Tube	<input type="checkbox"/>	Cut Too Short	<input type="checkbox"/>	Misread	<input type="checkbox"/>	Power Loss/Surge		
<input type="checkbox"/>	Ripples in Bend	<input type="checkbox"/>	Drill Holes	<input type="checkbox"/>	Offset				
<input type="checkbox"/>	Torque Waves in Extrusion	<input type="checkbox"/>	Drawing	<input type="checkbox"/>	Out of Calibration				
<input type="checkbox"/>	Turning Sequence	<input type="checkbox"/>	Finish	<input type="checkbox"/>	Out of Sequence				
<input type="checkbox"/>	Wave/Twist in Tube	<input type="checkbox"/>	Folio	<input type="checkbox"/>	Outside Dimensions				

<b>DART AEROSPACE LTD</b>		<b>Work Order:</b>	89418
<b>Description:</b> Crosstube High Aft (412)		<b>Part Number:</b>	D412-664-203
<b>Inspection Dwg:</b> D412-664-243	<b>Rev:</b> E	<b>Page 1 of 1</b>	

Required Dimension	Min	Max
Height	24.24	24.50
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	8	--
Crushing	--	6%

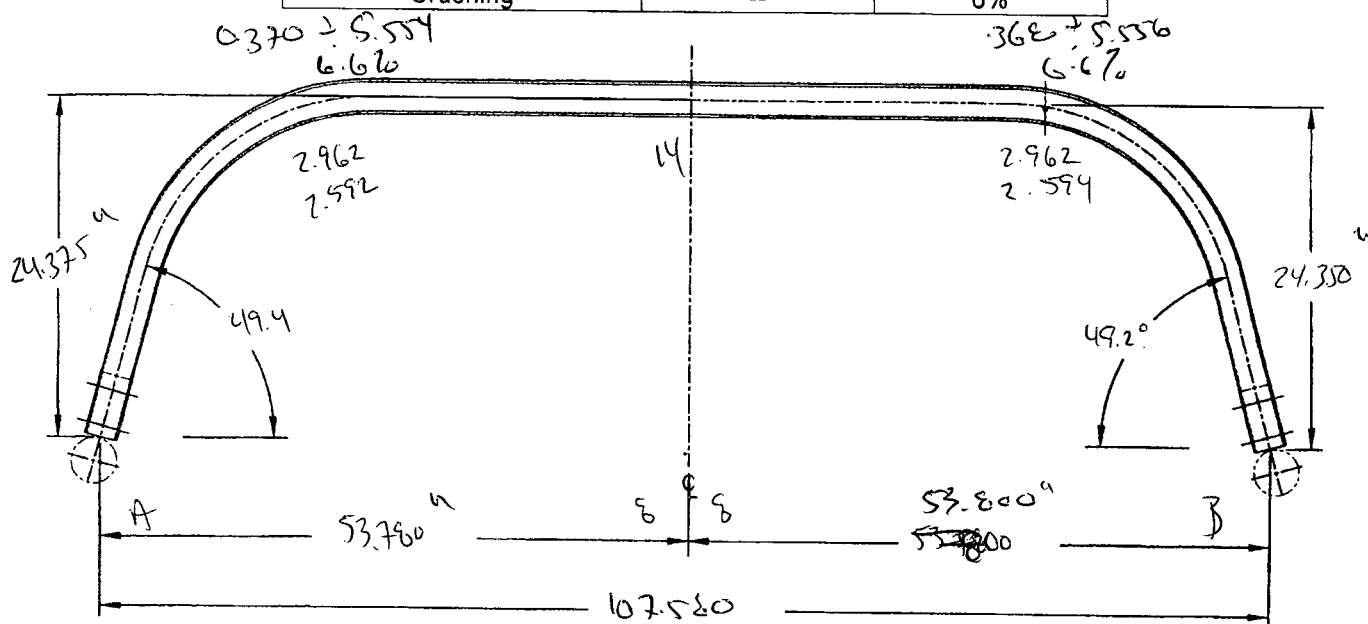

	Side A	middle	Side B
<b>Bending Passes</b>	8	14	8
<b>Crushing</b>	6.66%		6.66%
<b>Comments</b>			
Side A = 6.66% crush @ 8 passes			
middle = 14 passes			
Side B = 6.66% crush @ 8 passes			

<b>QC15 Inspection</b>	
<b>Date</b>	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. D	KJ/JLM	
C	10.02.02	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	

Item	Qty -243	Part Number	Description
1	X	D412-664-243	CROSSTUBE ASSEMBLY (412 HIGH AFT)
2	1	D6009-129	CROSSTUBE
3	2	D3595-063-570	RUBBER CUSHION
4	1	D2896-1	SUPPORT
5	2	D3189-1	CHAFING SHIELD
6	2	D2856-600-1009	ABRASION STRIP
7	4	MS21920-28	CLAMP
8	2	MS21920-30	CLAMP (OR MS21920-32)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

# **GENERAL NOTES:**

- 1) MATERIAL: MANUFACTURED FROM D6009-129  
FINISHED LENGTH = 124.100±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D412-664-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 47.0 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY. TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-30 CLAMPS (OR -32) WITH D3595-063-570 RUBBER CUSHIONS TO SECURE THE D2896-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 15) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY

SUBJECT TO APPROVAL

WITHOUT A TYPE

WORK ORDER


NO. 89418 MCT

12/08/22


2 DEO ATTACHED

RELEASED  
2009-10-29


E	REFORMAT/REVISE GENERAL NOTES; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; RELOCATED FLAG #6 PER PAR 08-046 (ZN A6-3); ADD TOLERANCE (ZN B6-3, C4-3, C8-3 & C5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	09.09.30
D	REMOVE D2732-058, CHANGE TO D3595-063-570	PH	07.03.09
C	REMOVE D2856-600-1087. ADD D2732-058 & MAGNOBOND 6398, MS21920-32 WAS MS21920-30	MB	06.10.27
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	01.10.17
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED	PH	DRAWING NO.	REV. E
MFG. APPR.	PH	D412-664-243	SHEET 1 OF 4
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

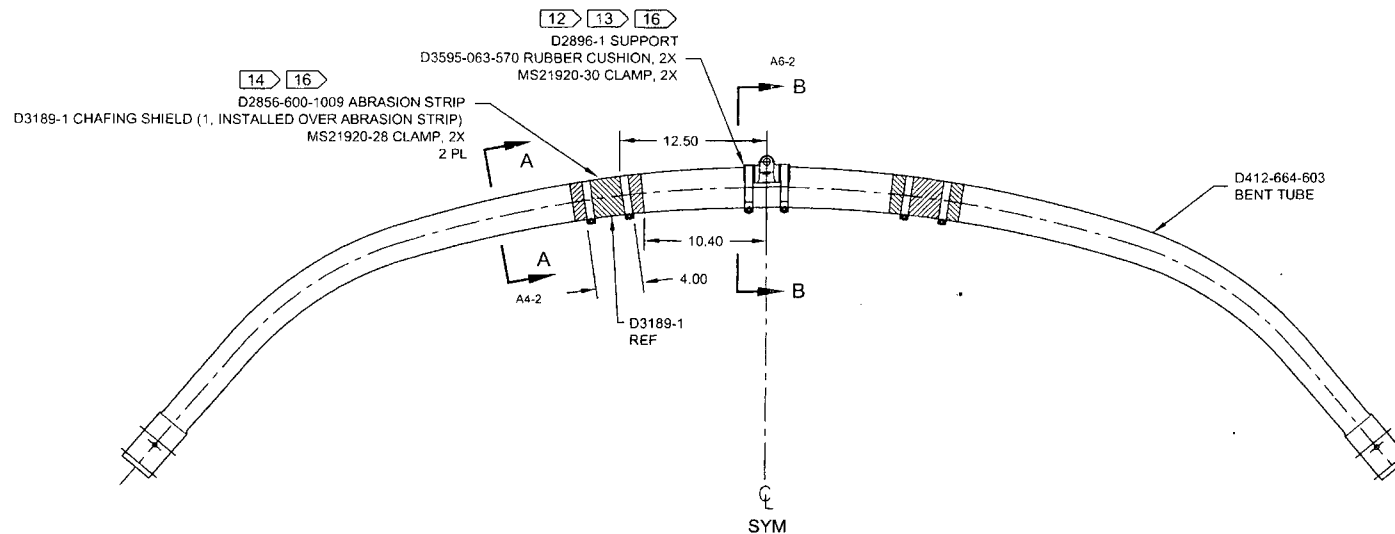

**D212-664-243**  
**ASSEMBLY DETAIL**

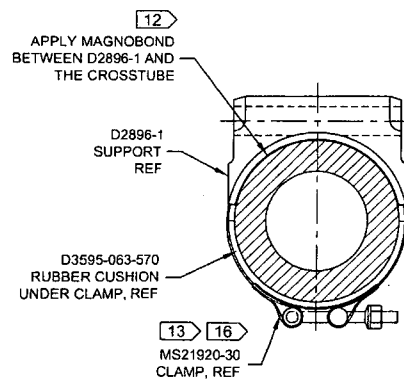

**SECTION B-B** D4-2  
SCALE 4X

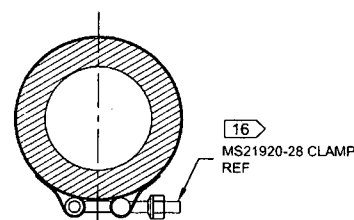


**SECTION A-A** C6-2  
SCALE 4X


2 DEO ATTACHED

**RELEASED**  
2009-10-28  
NWD


DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	B	D412-664-243	SHEET 2 OF 4
APPROVED	W	TITLE	SCALE
DE APPR.	W	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	<small>COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. NO PART IS TO BE REPRODUCED OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

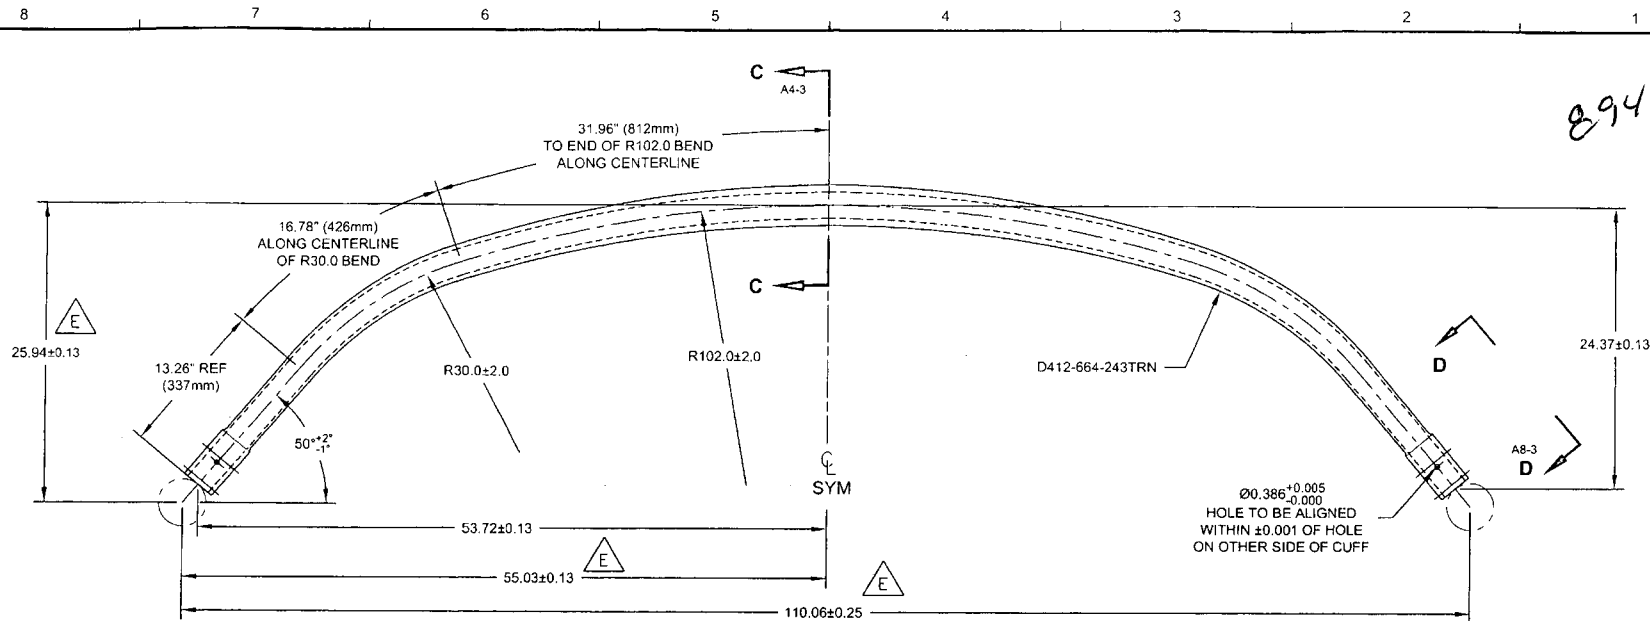

**D412-664-603** 10  
**BENDING AND DRILLING DETAIL** E

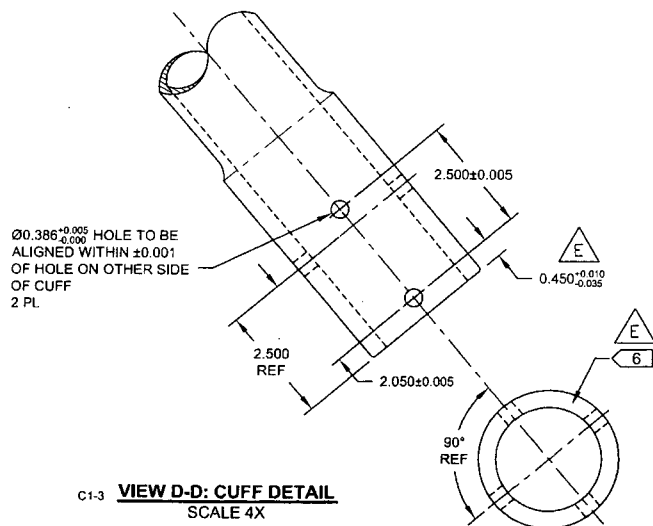

C1-3 **VIEW D-D: CUFF DETAIL**  
 SCALE 4X


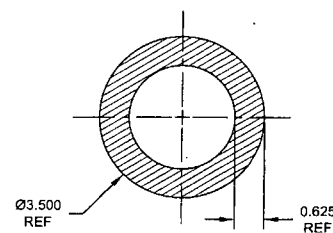


**SECTION C-C** D5-3  
 SCALE 4X

2 DEO ATTACHED  
**RELEASED**  
 2009-10-29  
 MP


DESIGN	PH	<b>DART AEROSPACE LTD</b>	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	DS	D412-664-243	SHEET 3 OF 4
APPROVED	AP	TITLE	SCALE
DE APPR.	H	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

29418

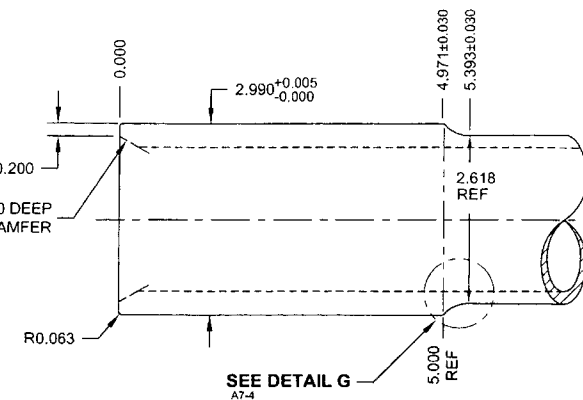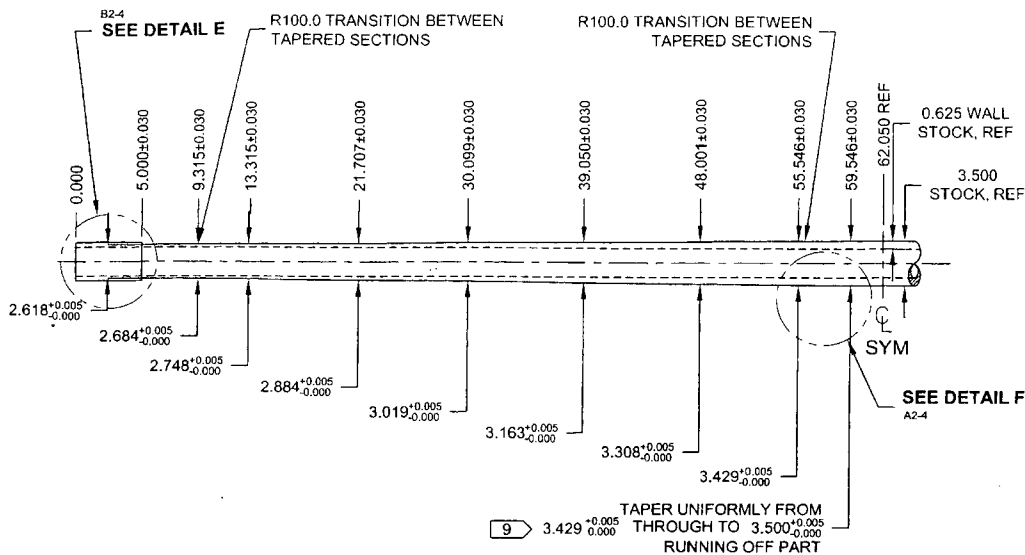


DETAIL E:  
 CROSSTUBE CUFF D8-4  
 SCALE 5X

D412-664-243TRN  
 TURNING DETAIL

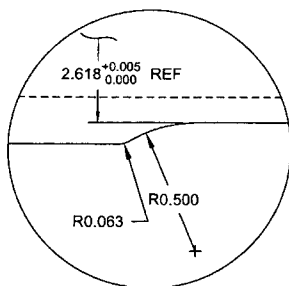

DETAIL G:  
 CUFF TRANSITION C2-4  
 SCALE 10X

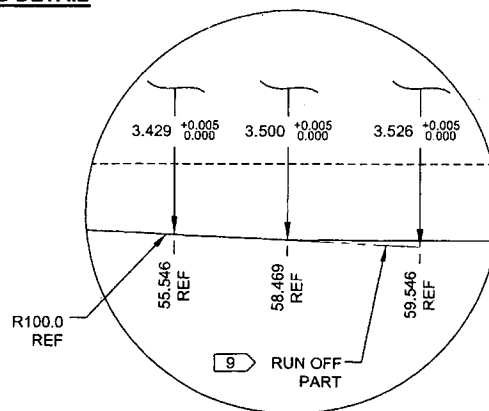

DETAIL F:  
 TAPER RUN-OFF C4-4  
 NOT TO SCALE

2 DEO ATTACHED

RELEASED  
 2009-10-29

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. E
MFG. APPR.	Q	D412-664-243	SHEET 4 OF 4
APPROVED	Q	TITLE	SCALE
DE APPR.	Q	CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2001 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED <i>MP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 11.03.31	DATE 11/03.31	DATE 11.03.31	DATE 11/03.31		DATE 11.03.31		

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1009	ABRASION STRIP

**WAS:**

6	2	D2856-600-1009	ABRASION STRIP
---	---	----------------	----------------

NOTES 2 AND 14, SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1  
CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL  
PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF  
PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1009 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF  
CROSSTUBE PER QSI 035.

**RELEASED**  
2011-04-07  
*MP*

COPYRIGHT © 2011 BY DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.



DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.		
DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31	DATE 11.03.31		

**IS:**

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)  
MS21920-28 CLAMP, 2X  
2 PL

D412-664-603  
BENT TUBE

2.00  
1.00

**WAS:**

D2856-600-1009 ABRASION STRIP  
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)  
MS21920-28 CLAMP, 2X  
2 PL

D3189-1  
REF

**D412-664-243  
ASSEMBLY DETAIL**

**RELEASED**  
2011-04-07

2  
MASK AREA PRIOR TO PAINTING AND  
APPLY CLEAR COAT AFTER PAINTING

2.00

Q  
SYM

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASS'Y (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>97</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>RE</i>	APPROVED <i>MM</i>		DE APPR. <i>HA</i>		
DATE 11.09.07	DATE 11.09.19	DATE 11.09.19	DATE 11.09.19		DATE 11.09.19		

**PURPOSE:**

REPLACE MAGNOBOND WITH 3M DP460 SCOTCH-WELD EPOXY ADHESIVE

**CHANGE:**

IS:

Item	Qty -243	Part Number	Description
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD

WAS:

9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	----------------	---

NOTE 12 & 16, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) INSTALL D2896-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015. LET CURE FOR 24 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVE HAS CURED FOR 24 HOURS.**

WAS:


- 12) INSTALL D2896-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2896-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**RELEASED**  
2011-09-29  
*MM*



CRUSHING OF D412-664-243

Acceptability of 8% CRUSHING AT END OF BEND

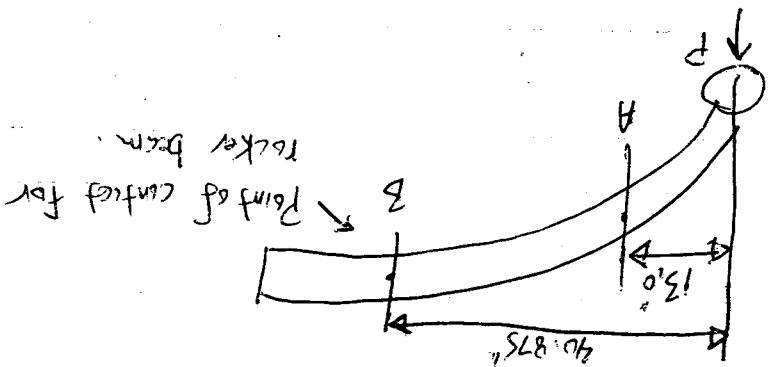

Point A:  $WD_1 = 2.961$ ,  $WD_2 = 2.522$

CRUSHING =  $(2.961 - 2.522) / (2.961 + 2.522) = 8\%$   
 $I = 1.676 \text{ in}^4$  (from AutoCAD)

Point B:  $WD_1 = 3.307$ ,  $I = 4.613 \text{ in}^4$

A:  $F = Mc/I = P \times 13 \times 2.961 / 2 \times 1.676 = 11484.4 \cdot P$   
 B:  $" = P \times 40.875 \times 3.307 / 2 \times 4.613 = 14.651 \cdot P$

M.S. =  $14.651 / 11.484 - 1 = 0.27$

∴ Tube will break at rocker beam contact before area of 8% crushing, 8% crushing in area at end of tube  
 bend is acceptable

11.12.06

11.12.06





## LIQUID PENETRANT TEST REPORT

P- 12197

CLIENT Int Aerospace DATE August 29/12 PAGE 1 OF 1  
ATTENTION ANDY/LINDA ACUREN JOB NO. 188-12-C0341 TIME AM ☒ PM ☐  
ADDRESS 1270 ABERDEEN ST POWO No. 17805  
HAWKESBURY, ON. WORK LOCATION SAME  
PROJECT F.P.I. on cross tubes ACCEPTANCE STD ASTM 1417/051038 REV./DATE 2005  
ITEM(S) EXAMINED (4)

JOB DESCRIPTION SEE RESULTS PROCEDURE No. LT-001 REV./DATE 2008 TECHNIQUE No. LT-002 REV./DATE 2008  
PART NO. SEE RESULTS MATERIAL ALUMINUM THICKNESS VARIABLE  
SCOPE A WET FLOWERS CNT LIQUID PENETRANT EXAMINATION  
WAS CARRIED OUT ON THE 100% OF SURFACE ONLY

## TEST DETAILS

METHOD ☒ FLUORESCENT ☐ VISIBLE ☒ WATER WASH ☐ SOLVENT REMOVABLE ☐ POST EMULSIFIED  
FAMILY BRAND MAGNAFLUX BLACK LIGHT S/N 16459 ☐ OUTPUT > 1000  $\mu$ W/cm<sup>2</sup> ☐ AMBIENT < 2 fc  
PENETRANT 2 L07 MINIMUM DWELL TIME 45 MIN. LIGHTING EQUIP. ☐ FLASHLIGHT ☐ TROUBLELIGHT ☐ OUTPUT > 100 fc @ SURFACE  
PENETRANT REMOVER H2O MINIMUM DRY TIME >10 MIN. OTHER LAPING  
DEVELOPER SKDS2 MINIMUM DWELL TIME 10 MIN. LIGHT METER S/N 1098866 CAL DUE DATE 11/26/12  
DEVELOPER TYPE ☒ NON AQUEOUS ☐ AQUEOUS ☐ DRY

## TEST SURFACE

SURFACE CONDITION ☐ AS GROUND ☐ AS WELDED ☒ MACHINED ☐ SHOT BLASTED ☒ CLEAN BARE METAL  
SURFACE TEMPERATURE ☐ < -4°C/ 20°F ☐ -4°C/ 20°F TO 10°C/50°F ☒ 10°C/50°F TO 52°C/125°F ☐ > 52°C/125°F

RESULTS- ☒ METRIC ☐ IMPERIAL

CROSS TUBE W.O. #S

1	"	"	89418	✓
1	"	"	89416	✓
1	"	"	89417	✓
1	"	"	88285	✓

12 09 06

Scope of Services  
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as a representation or warranty. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the services provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.  
Standard of Care  
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

## SIGNATURES

CLIENT REPRESENTATIVE Andy Sheldar DTR # E-120583  
TECHNICIAN (SIGNATURE): [Signature] REPORT REVIEWED BY: [Signature]  
NAME (PRINT): [Signature] NAME INITIALS  
CGSB LEVEL 1 SNT LEVEL 6606 CGSB LEVEL 1 SNT LEVEL 6606  
CGSB REG. No 6606 CGSB REG. No 6606

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 1 OF 3	SCALE NTS
DRAWN 97	CHECKED A	MFG. APPR. A	APPROVED MP		DE APPR. MP		
DATE 12.08.21	DATE 12.08.30	DATE 12.08.30	DATE 12/8/30		DATE 12.08-30		

**PURPOSE:**

REMOVED ABRASION STRIP IN FAVOR OF A THIN LAYER OF PROSEAL 890. UPDATE INSTALLATION OF CHAFING SHIELDS AND REDUCE TORQUE TO 40-50 IN-LBS. THIS ENGINEERING ORDER SUPERCEDES DEO D412-664-243-E-1.

**CHANGE:**

PARTS LIST IS AMENDED AS FOLLOWS:

**IS:**

Item	Qty -243	Part Number	Description
6	0	D2856-600-1000	ABRASION STRIP

**WAS:**

6	2	D2856-600-1000	ABRASION STRIP
---	---	----------------	----------------

NOTES 2, 14, AND 16 ON SHEET 1 ARE AMENDED AS FOLLOWS:

**IS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA)  
PAINT OUTSIDE PER DART QSI 005 4.2  
AFTER PAINTING, APPLY CLEAR COAT ON HATCHED AREA
- 14) APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D3189-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEALED D3189-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
- 16) TORQUE CLAMPS ON D2896-1 SUPPORT 80 TO 100 IN-LB. **TORQUE CLAMPS ON D3189-1 CHAFING SHIELD 40 TO 50 IN-LB.** ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

**WAS:**

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2  
PAINT OUTSIDE PER DART QSI 005 4.2
- 14) INSTALL D2856-600-1000 ABRASION STRIPS WITH A 0.13 REF GAP ON BOTTOM SIDE OF CROSSTUBE PER QSI 035.
- 16) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED  
2012-09-04  
MP

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>						
<b>Root Cause</b>	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
<b>FAULT CATEGORY</b>												
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  _____ _____ _____		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled  <input type="checkbox"/> Other _____ _____ _____	




DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 2 OF 3	SCALE NTS
DRAWN <i>MP</i>	CHECKED <i>MP</i>	MFG. APPR. <i>MP</i>	APPROVED <i>MP</i>	DE APPR. <i>MP</i>		
DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	DATE 12.08.21	

**IS:**

D3189-1 CHAFING SHIELD (1, INSTALLED OVER PROSEAL 890)  
MS21920-28 CLAMP, 2X  
2 PL

D412-664-603  
BENT TUBE

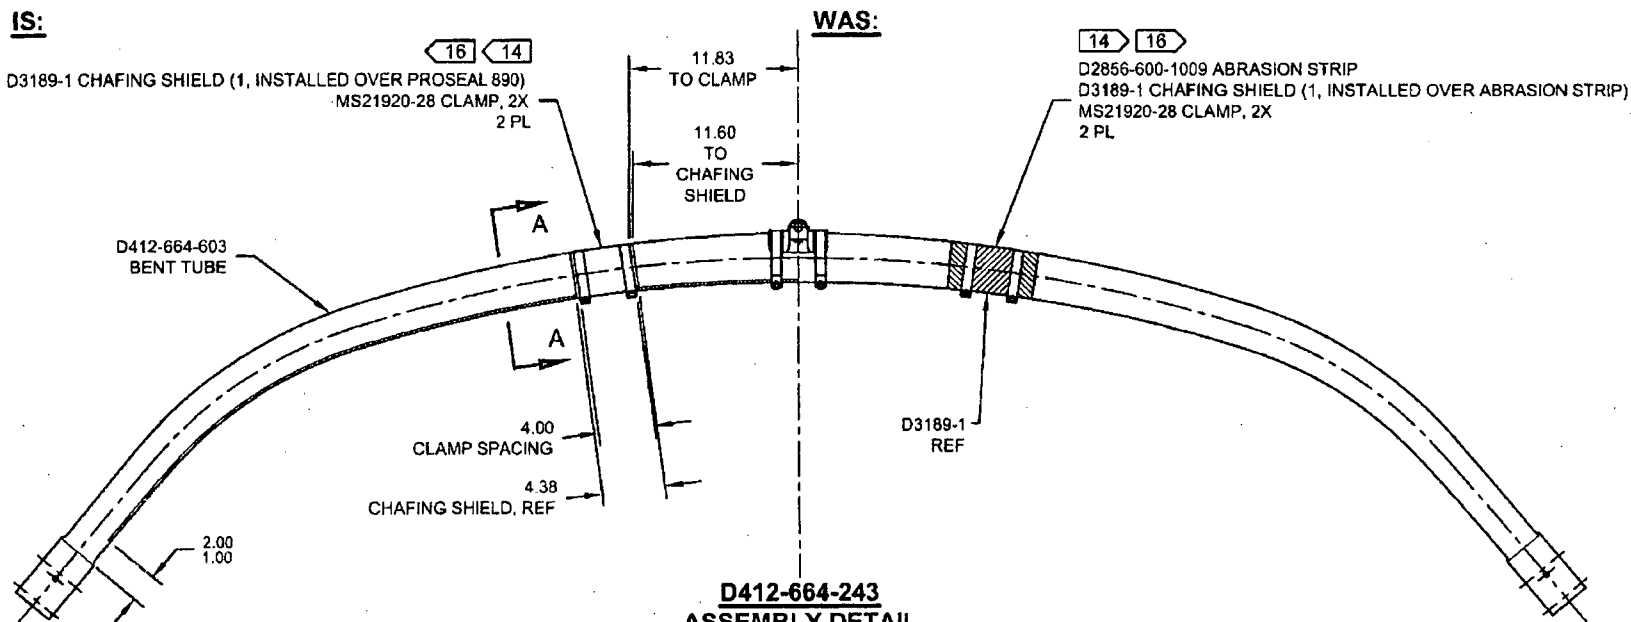


**WAS:**

D2856-600-1009 ABRASION STRIP  
D3189-1 CHAFING SHIELD (1, INSTALLED OVER ABRASION STRIP)  
MS21920-28 CLAMP, 2X  
2 PL

D3189-1  
REF

**D412-664-243  
ASSEMBLY DETAIL**

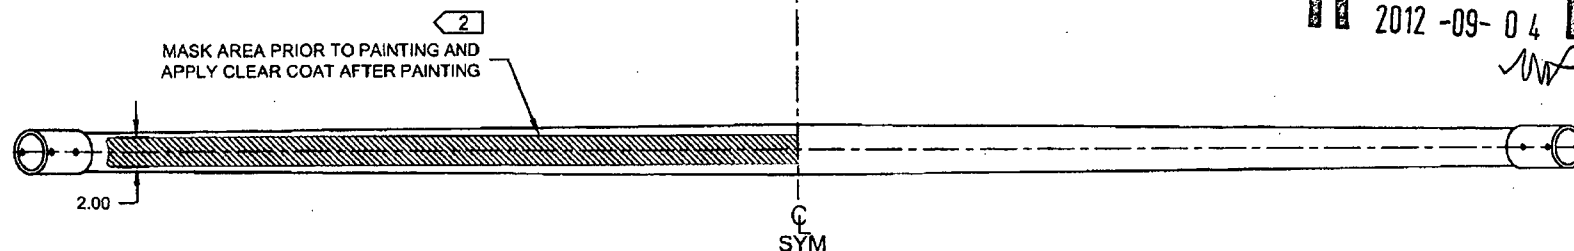

**RELEASED**  
2012-09-04  
*MP*

**COPYRIGHT © 2012 BY DART AEROSPACE LTD**  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_


Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

**FAULT CATEGORY**

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---

DRAWING NO. D412-664-243	TITLE CROSSTUBE ASSEMBLY (412 HI AFT)	REV. E	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D412-664-243-E-4	SHEET NO. SHEET 3 OF 3	SCALE NTS
DRAWN <i>MP</i>	CHECKED <i>MP</i>	MFG. APPR. <i>MP</i>	APPROVED <i>MP</i>		DE APPR. <i>MP</i>		
DATE 12.08.21	DATE 12.08.27	DATE 12.08.29	DATE 12.08.29		DATE 12.08.29		

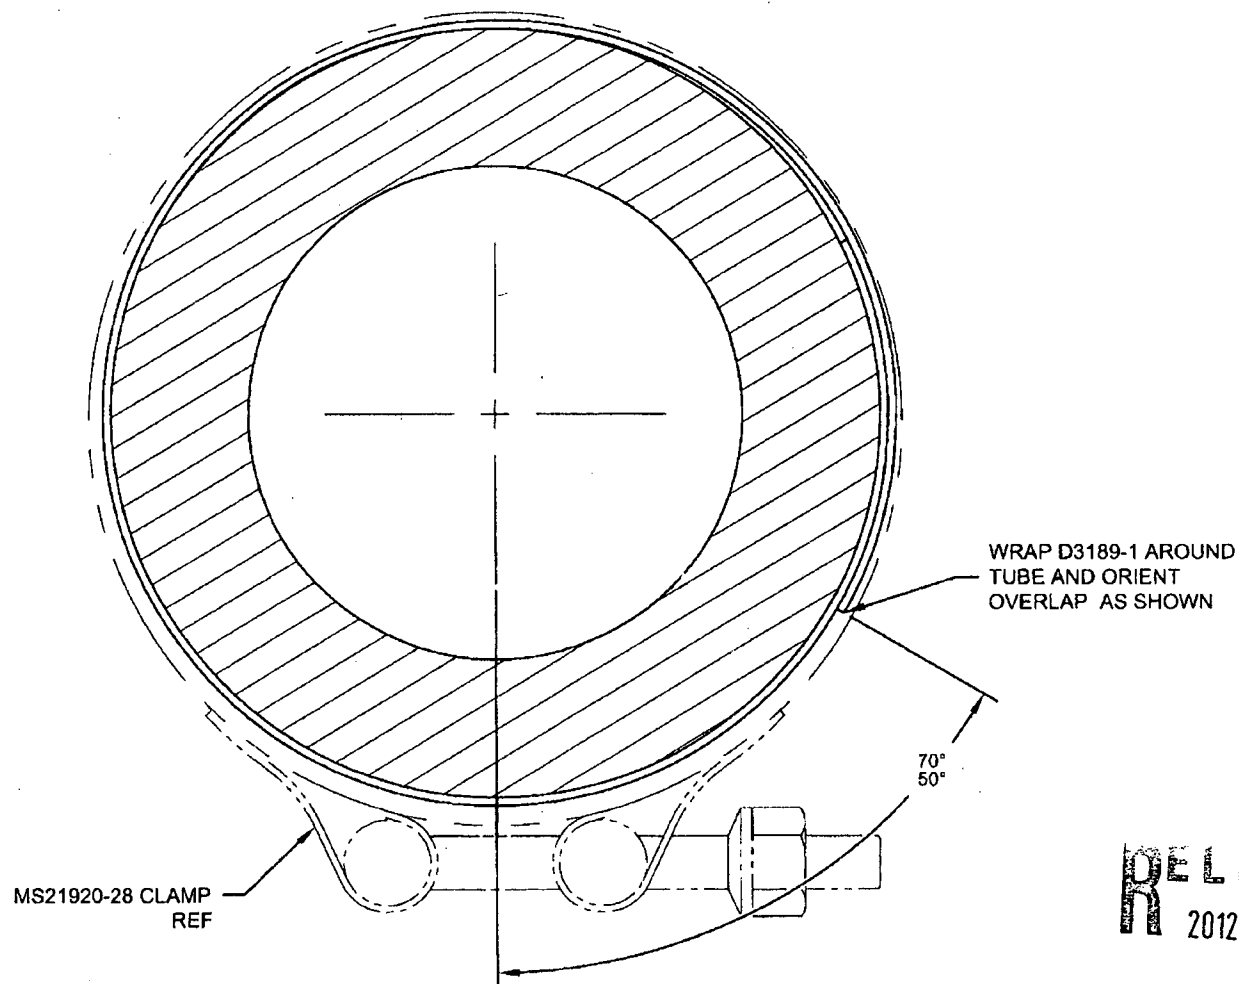

**SECTION A-A**  
CHAFING SHIELD DETAIL  
VIEW ROTATED, NOT TO SCALE

RELEASED  
2012-09-04  
*MP*

COPYRIGHT © 2012 BY DART AEROSPACE LTD  
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS  
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT  
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____	<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>  <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

### FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions  <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	--

## Linda Lacelle

---

**From:** Mike Petsche <mpetsche@dartaero.com>  
**Sent:** September-19-12 1:50 PM  
**To:** 'Linda Lacelle'; 'Isam el Kassis'  
**Cc:** 'Bill Beckett'; 'Chris Provencal'; 'David Shepherd'; psmith@dartaero.com  
**Subject:** RE: Crosstube

We'd need it to have been NDT'ed. And that puts it more than a week away. I spoke with Bill. He's ok with scrapping it.

---

**From:** Linda Lacelle [mailto:llacelle@dartaero.com]  
**Sent:** Wednesday, September 19, 2012 1:46 PM  
**To:** 'Mike Petsche'; 'Isam el Kassis'  
**Cc:** 'Bill Beckett'; 'Chris Provencal'; 'David Shepherd'; psmith@dartaero.com  
**Subject:** RE: Crosstube

I will have some ready next Tuesday (not NDT'd), can it not wait until then? If not I understand, just wanted to give you an option, and without having to scrap a painted one...

LL

---

**From:** Mike Petsche [mailto:mpetsche@dartaero.com]  
**Sent:** September-19-12 1:40 PM  
**To:** Linda Lacelle; Isam el Kassis  
**Cc:** Bill Beckett; Chris Provencal; David Shepherd; psmith@dartaero.com  
**Subject:** Crosstube

IEK/LL

Could you please pull a 412 aft crosstube from stock for fatigue testing? (Per the eng meeting today).

The paint needs to be stripped and the chafing shields removed....not necessarily in that order.... We are going to send it to Exova to start our testing over. It would be great if it were ready this week so Exova can get back to the testing ASAP.

Thanks.

w/o RD3388.

*Mike Petsche*

Design Manager

DART Aerospace

Phone: 613-632-5200

Mobile: 514-833-1657

NCR: Yes / No

**WORK ORDER NON-CONFORMANCE / UPDATE**

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____  Part No. _____  NCR No. _____				<b>DISPOSITION</b>  Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		<b>AGAINST DEPARTMENT/PROCESS</b>  <div style="display: flex; justify-content: space-between;"> <div>           Skid-tube <input type="checkbox"/>            Machining <input type="checkbox"/>            Thermoforming <input type="checkbox"/>            Large Fab <input type="checkbox"/> </div> <div>           Crosstube <input type="checkbox"/>            Small Fab <input type="checkbox"/>            Finishing <input type="checkbox"/>            Composite <input type="checkbox"/> </div> <div>           Water Jet <input type="checkbox"/>            Prod. Eng. Coord. <input type="checkbox"/>            Rec/Store/Packaging <input type="checkbox"/>            Supplier <input type="checkbox"/> </div> <div>           Engineering <input type="checkbox"/>            Quality <input type="checkbox"/>            Other <input type="checkbox"/> </div> </div>					
<b>Root Cause</b>	<b>Date</b>	<b>Step</b>	<b>Qty</b>	<b>Description of work order update or Non-conformance</b>	<b>Initial Chief Eng</b>	<b>Action Description</b>	<b>Sign &amp; Date</b>	<b>Verification</b>	<b>QC Inspector</b>		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY			
<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge  <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

NCR: Yes / No

## WORK ORDER NON-CONFORMANCE / UPDATE

DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Work Order: _____	<b>DISPOSITION</b> Rework <input checked="" type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	<b>AGAINST DEPARTMENT/PROCESS</b>			
Part No. _____		Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>
NCR No. _____		Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>
		Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>
		Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data			2	INSTALL CHAFING SHIELD PER DED 17412-664-243. MS21920-28 B/N 122518 D3189-1 B/N 999004 Prosc 890 B/N 123103	DAS 12 12/9/20	RE-INSTALL CHAFING SHIELD ON STRIPPED TUBE	12/9/20		
Equip/Tooling									
Operator									
Material	12/9/20	230			12/9/20				
Setup									
Other									
Process	12/9/20	230	1	Install Support: D2898-1 B/N: _____ DP460 B/N: _____ MS21920-28 B/N: _____	DAS 12 12/9/20	RE-INSTALL SUPPORT ON STRIPPED TUBE → WAS NOT REMOVED, FR STRIPPING			
Supplier									
Training									
Unapproved									

## FAULT CATEGORY

<b>Landing Gear</b> <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	<b>General</b> <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge	<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	---	--	---